



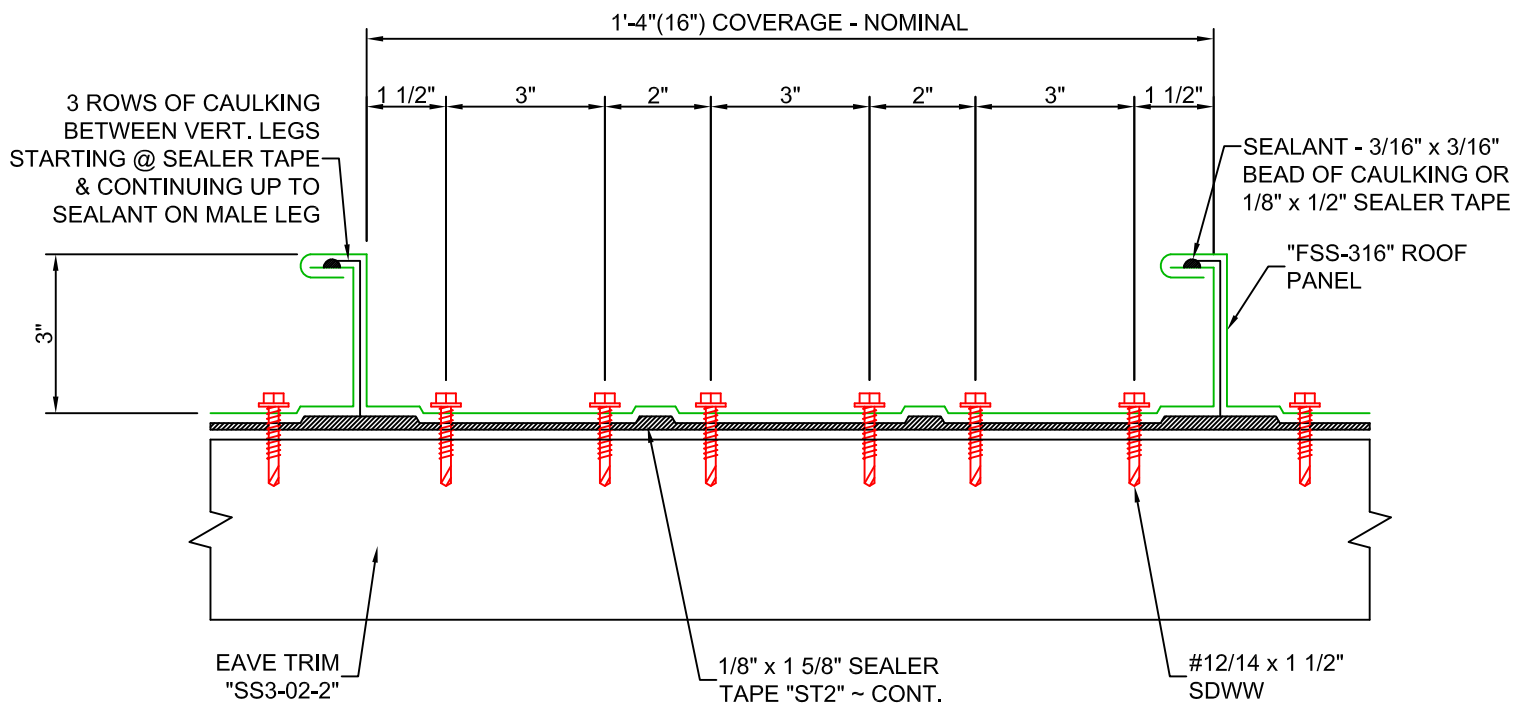

EAVE FASTENING DETAIL


**** IMPORTANT ****

FAILURE TO FOLLOW DIRECTIONS BELOW COULD RESULT IN PROBLEMS WITH ACHIEVING WEATHERTIGHTNESS & COULD CAUSE PROBLEMS WITH ATTACHMENT OF TRIM OR FLASHINGS.

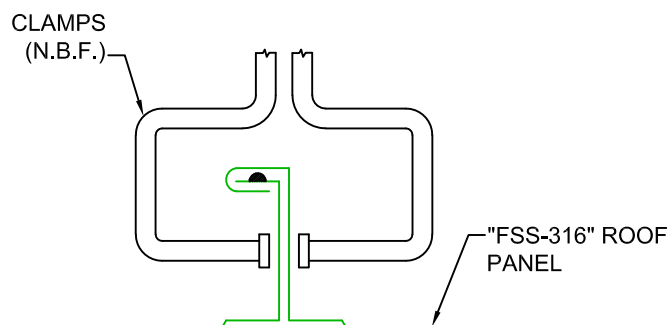

ERECTOR NOTE:
VERTICAL LEGS OF PANELS MUST BE HELD TIGHT TOGETHER USING CLAMPS @ EAVE, RIDGE, AND CLIP LOCATIONS. THIS MAINTAINS PROPER PANEL ALIGNMENT.

CORRECT

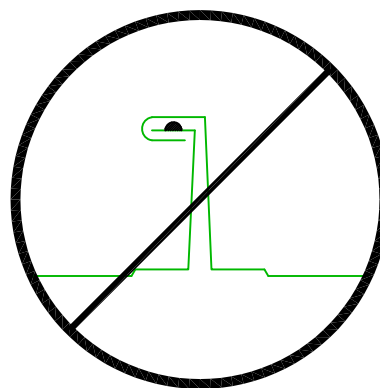

INCORRECT



BOX 515 RAILROAD STREET
SANDY LAKE, PENNSYLVANIA 16145-0515
PHONE: 800-245-0396 • FAX: 724-376-3864

"FSS-316" STANDING SEAM DETAILS

DRAWN BY: D. JUREY

DATE: 8/12/25

CHECKED BY:

DATE:

EAVE FASTENING

DRAWING NO.

FSS316-3